(4) Call service 4000 - Laser scanner unit [Polygon motor] error

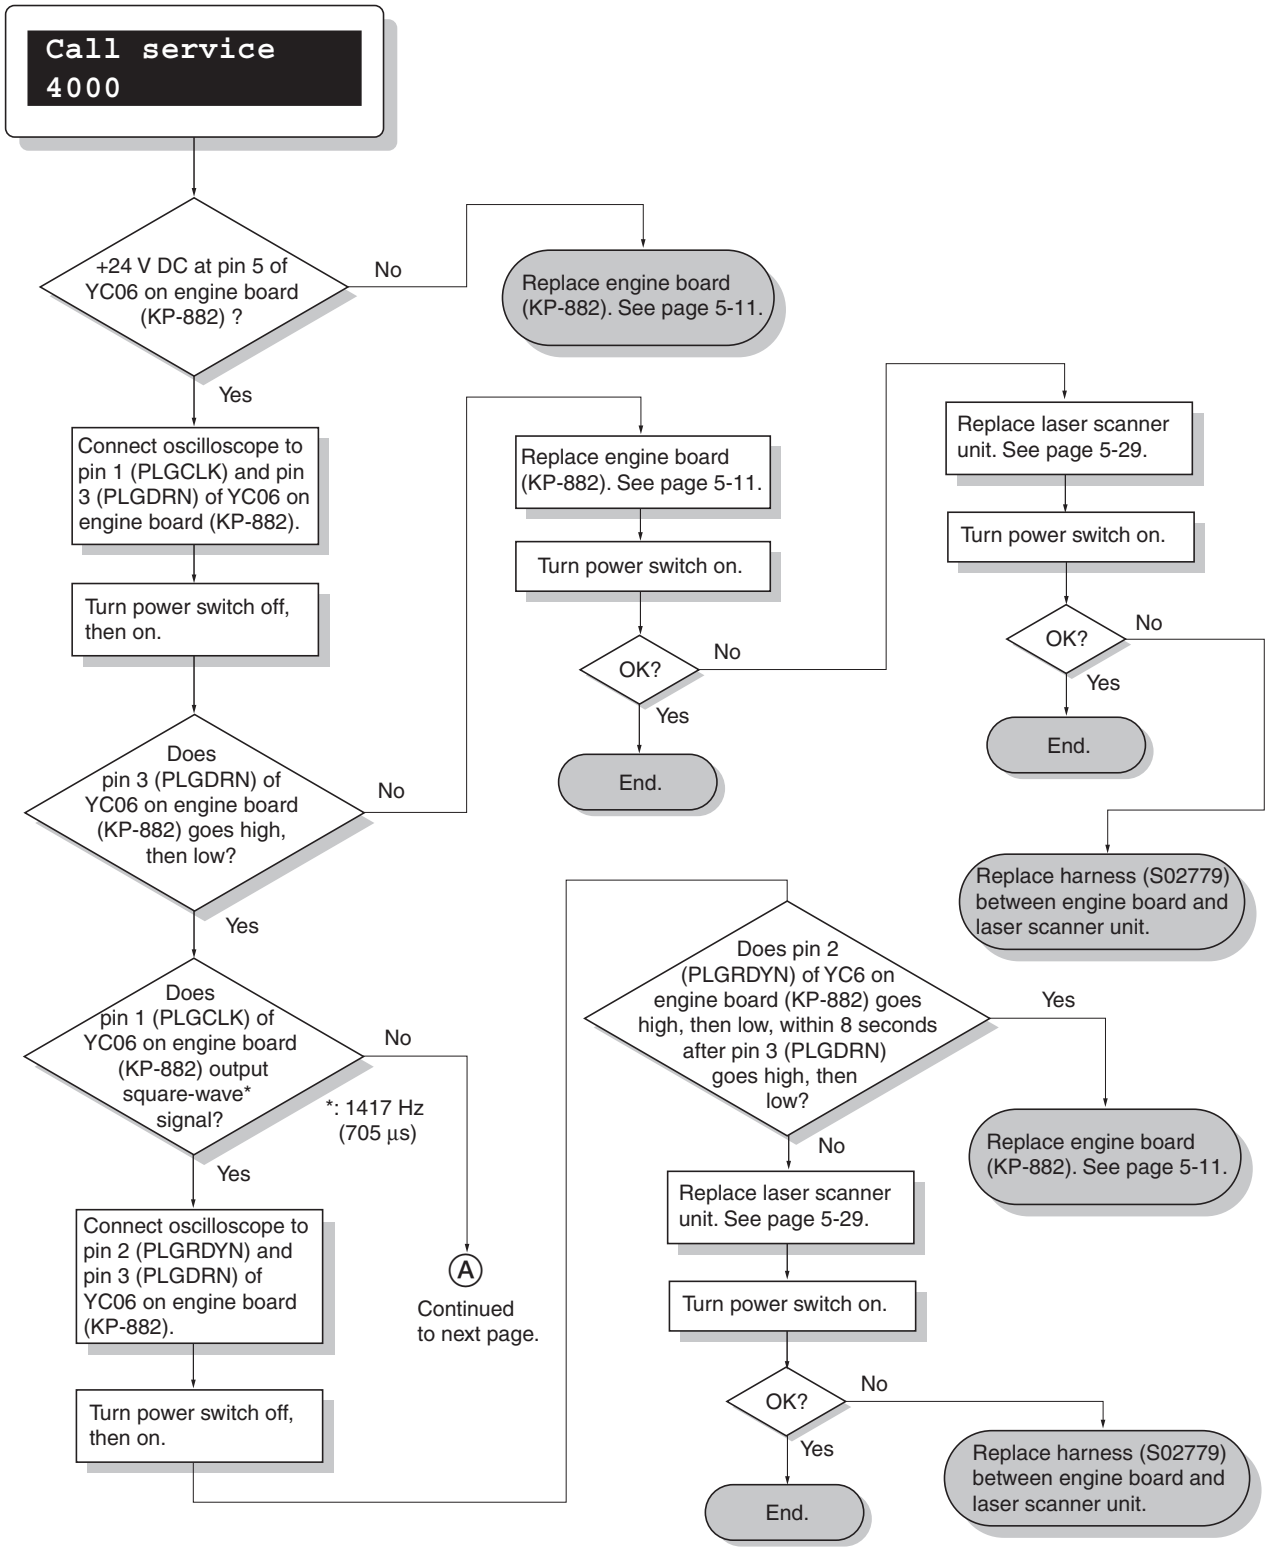

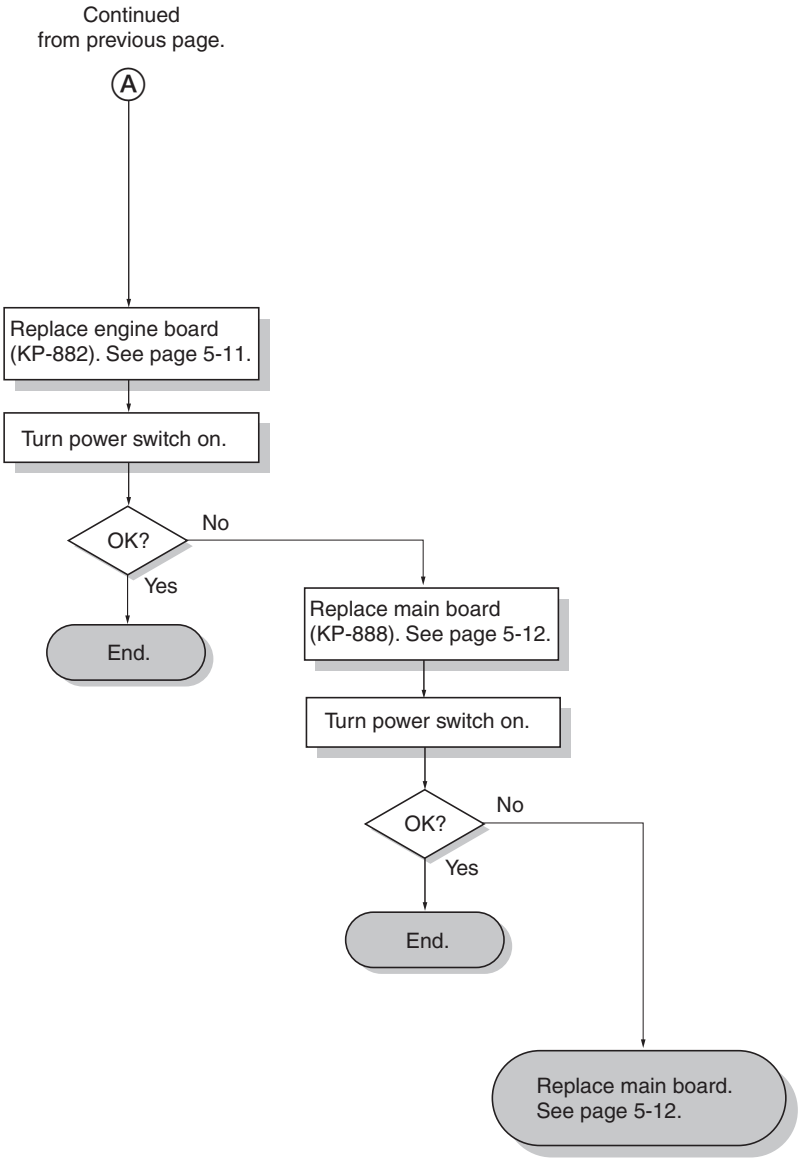
Continued
from previous page.
A
Replace engine board
(KP-882). See page 5-11.
Turn power switch on.
OK?
No
Yes
End.
Replace main board
(KP-888). See page 5-12.
Turn power switch on.
OK?
No
Yes
End.
Replace main board.
See page 5-12.